COPS SOFTWARE IMPROVEMENT AND ADJUSTMENT

Yevgeniy Orishchin (<u>orischin@pnpi.spb.ru</u>) Vladimir Sknar (sknar@hep486.pnpi.spb.ru) March-May 2000

The main aim was to make working the new COPS boards, developed by Sten Hansen.

Software for the on-board ADSP2185L DSP processor has been written by Eric Cowden and John Lofgren ("COPS SOFTWARE USERS GUIDE" 11/22/99).

Development tools for the Analog Devices assembly language were kindly lent by Sten Hansen. Sten also answered questions arising.

Most of modification were related with UART's, since beginig, when there were no responses from COPS card.

History of modifications is depicted in addendum. Here are the main modifications in software:

□ Multiple echoes and prompts on power-up are removed.

- ☐ Transmitting throw UART's are made buffered, thus eliminating data corruption while reading CCD data to the PC.
- □ Work with UART's control registers is corrected.
- □ Internal delays adjusted.
- □ Two new commands added (see HE command output, or addendum below).

Files

All required files are on the diskette in directory A2.1c.

acops.dsp acops.sys acopsboo.BNM asm.bat asmsplfx.bat bnmfix.exe improve.doc makebnm.bat makeboot.bat MAPREAD.EXE shortbnm.bat What.txt

This is a copy of $C: \alpha \log \alpha > A2.1c$ directory on CMSPROJ05 computer.

Addendum

History of modifications as from source acops.dsp file

(in reverse chronological order)

A2.1c 10-17 MAY-2000 acops.dsp

- ◆ .CONST Max_Number_of_Boards = 21; (initially 8)
- ♦ At startup init:

SET FL1; SET FL2; changed to RESET FL1; SET FL2;

- ◆ FL2 (+5V power supply for ADC) is not switched off, APO affects FL1 (9V) only.
- ♦ All previous allow decreasing POWER UP timeout for CC command, and making more reliable work.
- ♦ At startup init:

Multiple prompts and echoes are eliminated.

A2.1b 25-APR-2000 acops.dsp

.CONST Max_Number_of_Boards = 17; (initial 8)

At startup init:

SET FL1; SET FL2; changed to RESET FL1; RESET FL2;

 Old Boards problem with this program is, that works OK in path-throw mode and if first in chain, but if not 1st misses characters on CD command.

Solution: check TSR, THR both ready before IO(UARTx) (DONE)

A2.1a 21-APR-2000 acops.dsp

~~~~

- New subroutine added:
  - Send\_CharBA used at UART-B receiver interrupt service only
    This affects Send\_CharA also.
- Added: RESET FL0; SET FL0; in the Echo-back ISR
- A2.1 18-APR-2000 acops.dsp (from BCOPS.DSP V2.0 (see below))

---

 Added ability to read CCD-s on ALL boards simultaneously and output CCD data in one reading;

Two new commands were entered:

CA - Convert All (Convert\_All\_CCD)
PA - Print All (Print\_All\_CCD)

- Conversion\_Done\_Flag now used in for the end of conversion only
- Char\_Recently\_Sent\_Flag the only used for path throw control

# B2.0 bcops.dsp ( originally DCOPS.DSP V1.1b (see below))

- ♦ Modified, to provide asynchronous buffered transmission in both directions to eliminate possible data overrun in chain for large transmissions.
- ♦ Byte transmit calls are done from the timer interrupt service routine.
- While any transmit is active, timer interrupt interval is as follows:

- 3. UART's DLL, DLH setting with retries
- 4. SPORT1 Setting changed: set external clock

## V1.1a 24-MAR-2000

- Send\_CharA has been modified in waiting of THR and Shift reg. ready Now, after putting char in THR, waits either THR or Shift reg state is changed, then waits both are ready
- CC command (Convert\_Ctrl) is modified, added clearing of Pixel\_Effect\_n arrays (n=1,2,3,4)

### $V1.1 \sim 20-MAR-2000$

- 1. +5v +9v are enabled on StartUp (FL1,FL2)
- 2. IO memory wait states are chandeg to 7 (was IOWAIT0=5)
- 3. Init\_System corrected (jumps to Next\_CharLine and Char\_Erase, that could force us to continue in Get\_Line routine
- 4. Send\_CharA has been modified in waiting of THR and Shift reg. ready
- 5. Send\_CharAA has been removed as duplicating
- 6. UARTDIV symbol definition added (C style) for UART's divisor value. Default value is set to 11 and can be changed at compile time. For example, command:

MAKEBOOT dcops dcops04d "-dUARTDIV=4"

will compile, and produce bootable 'dcops04d.bnm' file, where UART's divisors will be set to 4.